

febi 172813

**To Fit:**

Audi A3 (8V), Q2 (GA)

SEAT Ateca (KH), Leon (5F)

Škoda Karoq, Kodiaq, Octavia III, Superb III

VW Atlas (CA), Golf 7 (5G, BQ, BA, BV, AU, AM, AN, BX), Teramont (CA), Tiguan 2 Allspace (BW2), Touran 2 (5T)



EN

Ignition Switch

Problem

The engine remains running when the ignition key is turned to the 'off' position but stops when the key is removed. Using a suitable diagnostic tool can show the following fault codes:

B11A511 – S contact, short to ground

B12E512 – Ter.15: signal, short to B+

B12E612 – Actuation relay terminal 15 load, short to B+

Cause

A fault can occur in the switch caused by internal tolerance issues which prevent the contacts from aligning correctly.

Solution

Check the continuity of the wiring loom to the ignition switch, if the readings are correct then proceed with changing the ignition switch. febi replacement part 172813 is manufactured to match the latest (modified) version. febi also has the ignition lock housing in range under article number 36044.

For more technical information please visit: partsfinder.bilsteingroup.com