

Technical modifications to the shield plate of the turbocharger

technical changes:

The vehicle manufacturer VW has made technical modifications to the shield plate, which is mounted on the exhaust manifold of the turbocharger.


Note:

Vehicles up to production date 15.11.2010 were delivered with a long shielding plate over all 4 cylinders of the exhaust manifold. Vehicles after 16.11.2010 were manufactured with a shortened shielding plate over the first two cylinders.

Therefore the turbocharger manufacturer has omitted the third and fourth threads for mounting the shielding plate since 01.07.2014.

Instructions:

If a long shielding plate 03L129969P is installed, this is to be replaced by the short variant 03L129969AD.

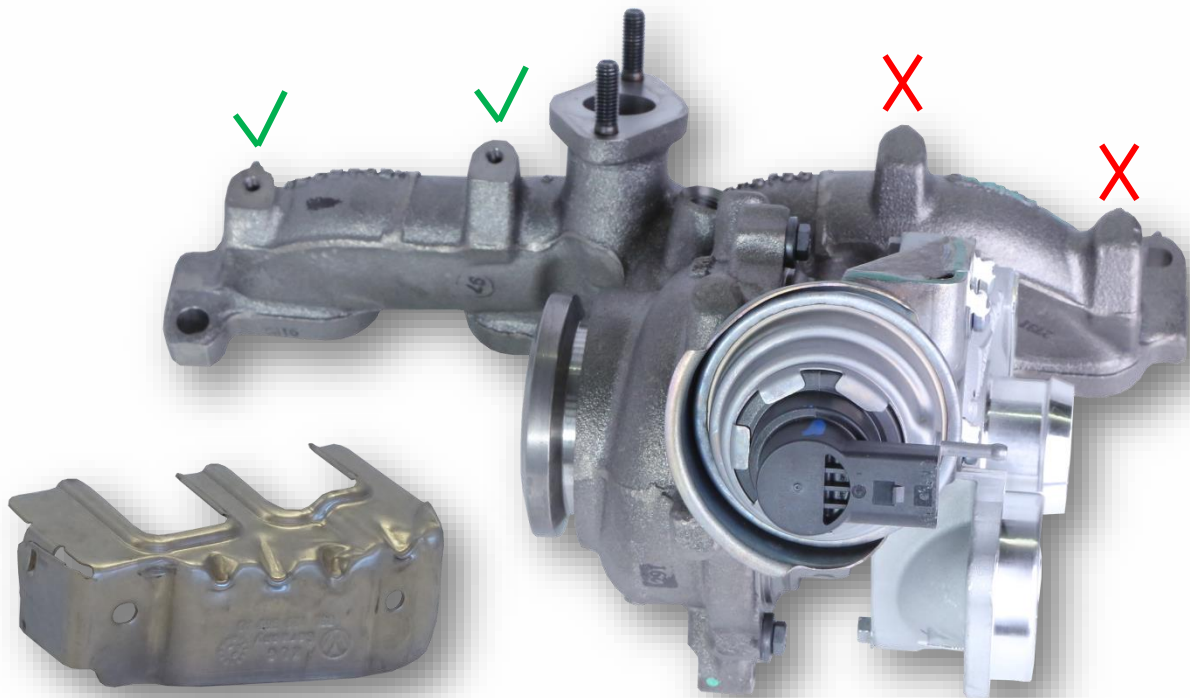

03L129969AD = BTS-Nr. D950130

Vehicle Manufacturer: VW

Vehicle: T5 Transporter, T5 Multivan

Engine code: CAAA, CAAB, CAAC, CAAD, CAAE, CCHA, CCHB

Validity: This service information is valid for renewing the turbocharger with

BTS reference: T915444 **BTS-Service-Set-Nr:** T981420

OE-no.: 03L253016M, 03L253016MV, 03L253016MX

Manufacturer part no.: 792290-5002S, 792290-5003S

Please note: OE-references are only for means of comparison. The content of this Service Information is non-binding and is only for informational purposes. The manufacturer specifications have to be adhered to.