


This new version replaces all previous versions. Please replace SI-110810

Whistling noise after short amount of time, bearing clearance is not increased

Note:

When fitting the individual gaskets of the exhaust manifold, please have a good look at their position. The passage may not be in the center and do not lie on the waste gas flue of manifold when mounted wrongly. This may already lead to leakages and whistling noises after driving for a short amount of time.

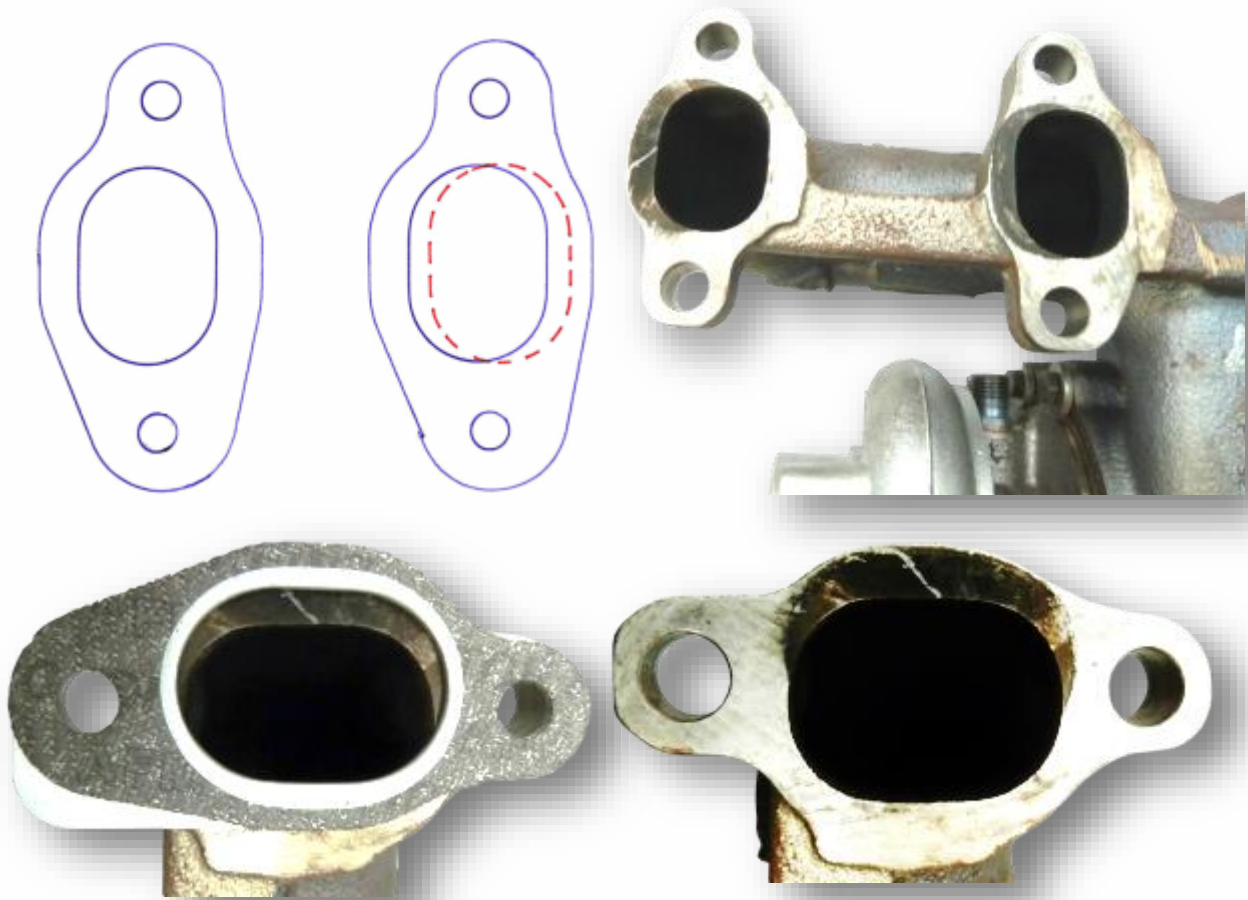

Vehicle Manufacturer: VW, Audi, SEAT, Skoda, Ford

Validity: This service information is valid for renewing the turbocharger with

BTS-Nr.: T911181, T911204, T911248, T911969, T912022, T912079, T912231, T912236, T912246, T912352, T912403, T912442, T914013, T914073, T914074, T914096, T914190, T914200, T914754, T914755, T914760, T914761, T915003, T915164, T916398, T916620, T916980,

and the corresponding mounting kits with **BTS-Nr:** T931086ABS, T931104ABS, T931142ABS, T931198ABS, T931215ABS

Please note: OE-references are only for means of comparison. The content of this Service Information is non-binding and is only for informational purposes. The manufacturer specifications have to be adhered to.